

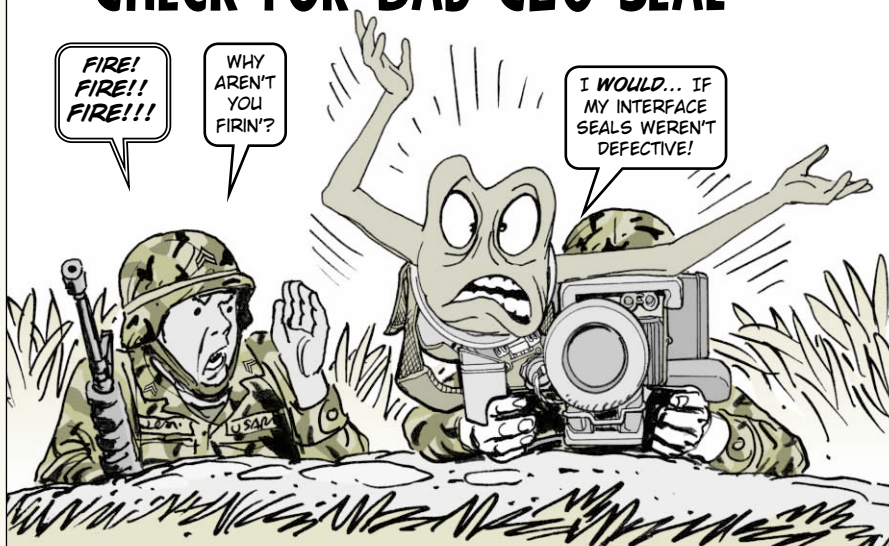


CHECK FOR BAD CLU SEAL

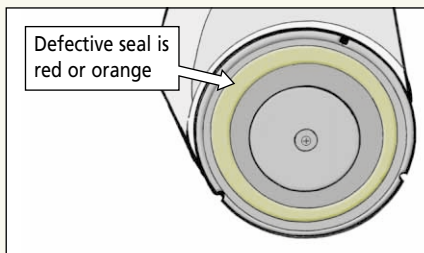

Defective interfacial seals for the Javelin missile system's command launch unit (CLU) round interface connectors have gotten into the field. The seals begin to come apart after only a few uses of the CLU, causing BIT failures and no communication between the CLU and the field tactical trainer or the Javelin round.

All Javelin units should immediately check all CLU round interface connectors—including spares—for the defective seal. Remove the protective cap from the connector and check the seal between the outer sleeve and the green barrel plug. If the seal is gray or translucent, it's OK. If the seal's red or orange, it needs to be replaced.

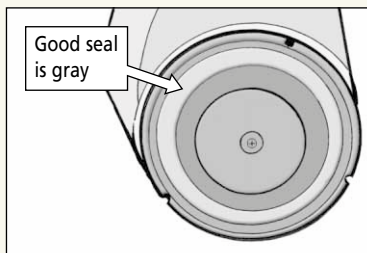

Tag the connector as defective and order a replacement connector through JAVTRAK, the Javelin requisitioning system, with NSN 5935-01-474-6361. After June, 2003, order the seal through the normal supply system.